



Field Service Bulletin

Date: March 3, 2000
Attention: Red Jacket Distributors
Subject: CpT Transducer Scotchcast Kit

Improper use of the Scotchcast Kit included with the Red Jacket pressure transducer can cause *Transducer Failure*.


Step by step scotchcast kit installation instructions are include with every scotchcast kit. The scotchcast kit should be warm to the touch before inserting the transducer connections into the resin bag. The warmth indicates that two chemicals in the scotchcast kit have bounded and the epoxy is ready. *All layers of the transducer cable insulation including the outer jacket must be sealed by the epoxy.* If all layers of insulation are not sealed then water can wick through the unsealed insulation layer. *Do not use the white wire* when connecting the pressure transducer, this may be clipped.

Thank you for your continued support of Red Jacket. For additional information, please contact your Red Jacket Regional Sales Manager or Red Jacket Technical Service at 1-800-952-8348.

Marley Pump
500 E. 59th Street
Davenport, IA 52807
Tel: (800) 262-7539
(319) 391-8600
Fax: (800) 304-7502

Marley Pump Europe
Gijsbert Stoutweg 8
4005 LE Tiel, Holland
Tel: 31/34 461-7909
Fax: 31/34 462-2408

Marley Pump Asia
46 East Coast Road
#04-04 Palace Centre
Singapore 428766
Tel: 65/345-4960
Fax: 65/345-4843

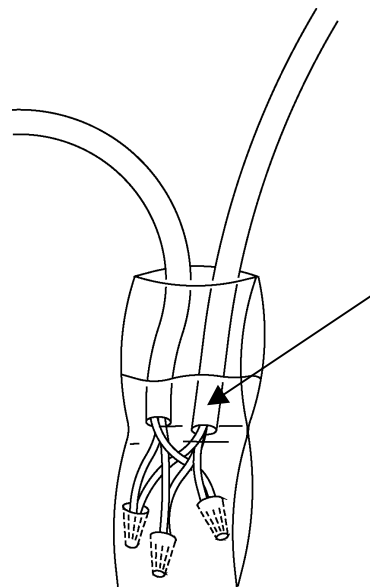

All wiring, including outer jacket should be completely submerged in epoxy.

FSB-311 02/00



Marley Pump
A United Dominion Company

» *Pump and Monitoring Technology Delivering Today's Vital Resources Worldwide*